

## APPENDIX D: Bridge Assessment Guidance

### FHWA/State DOT/FRA

## Preliminary Bat Assessment Guidelines for Bridges/Structures

#### DOT Environmental Division

*Adapted from the Indiana Department of Transportation 2010 Bridge Inspection Manual and the Bernardin, Lochmueller and Associates 2007 document.*

The guidelines in this document describe favorable characteristics of bridges/structures that may provide habitat for many bat species and preliminary indicators intended to determine if any bat species are using bridges/structures.

Individuals conducting reviews for bats must use the Bridge Assessment Form and must include a copy of the completed form in their project file. Individuals assessing bridges/structures should employ appropriate safety measures in conducting these reviews and avoid touching any bats. Recommended equipment include a flashlight (preferably a headlamp), hard hat, binoculars or spotting scope, digital camera, check list and a fine- to medium-point permanent marker or pen. It is advisable that individuals also consider having a dust mask, cellular phone, and boots if access beneath structures is desired. Easily removed, protective coveralls may be advisable if access requires crawling.

Bridge/Structure assessments conducted pursuant to the range-wide programmatic consultation are valid for one year from the date of the assessment. If a mist net or acoustic survey is used in place of the Bridge/Structure assessment protocols those surveys are typically valid for two years, but agencies should verify with the appropriate U.S. Fish and Wildlife Service (Service) Field Office. There is no requirement for a follow-up evaluation seven days prior to beginning construction provided the assessment or survey follows the required protocols.

#### Favorable Characteristics

##### Cracks in Concrete

Cracks in the concrete are used by bats as a foothold in roosting (Photo 1). In addition, some bats may be hidden from sight in wider cracks in the concrete and behind deteriorating concrete sections in the ceiling or walls. Look for cracking along support beams and inner walls especially below a fillet (a concrete filling between ceiling and vertical beam). During inspection, sounds may be heard coming from behind such cracks and/or expansion joints.

##### Expansion Joints (Bridges)

Expansion joints can provide protected cover for bats (Photos 2 and 3), but do not always provide habitat, depending upon whether they are obstructed by road debris or other blockages to use. If possible during the assessment, individuals should look into expansion joints or in other cracks with a flashlight. If joints are used by bats, often there will be guano under the joints (Photos 4-6), but not always, since the joint may be located over water.

### **Cave-like Environment**

While assessing bridges or structures, look for dark environments that mimic cave-like conditions such as under the deck in the case of a bridge (Photos 12 and 13) or an attic in the case of a structure. This may involve crawling under low areas so a hard hat is recommended. Such places (e.g., a concrete bunker secreted into a hillside with an open front) provide protection from wind, rain, sleet, hail and predators. Bats do not roost near the ground where predators (cats, raccoons, etc.) can reach them. Roosting is usually at least 4 feet from the ground.

### **Large Rivers in Wide Floodplains (Bridges)**

Many concrete bridges that span larger rivers in wide floodplains offer excellent areas for roosting, although bats are not restricted to using these sites. These areas tend to have an ample food supply and may also serve as historic flyways for bats during migration (i.e., March-May and September-November). These bridges may also offer opportunities for mating in late fall.

### **Preliminary Indicators of Bat Presence**

The four indicators presented here document physical observations that can easily be made for individual structures. Each of these indicators should be considered on its own merits and the presence of even one of these on a bridge is enough documentation to confirm bat usage. If questions arise regarding interpretation of these indicators, individuals should contact the District Environmental Manager for clarification or assistance. (NOTE: Some of these indicators, visual and sound, will not be present during normal hibernation periods, as bats do not hibernate under bridges. Hibernation usually occurs between September and May, but contact your local USFWS Field Office for exact dates.)

#### **Visual**

Look for bats flying or roosting (hanging) during the assessment (Photo 1, 2, & 8). A flashlight or headlamp will be needed and binoculars may be necessary when viewing higher areas. If bats are present; record numbers as best as possible and their locations. Note any dead or injured bats. A sketch map would be helpful (can use bridge plan sheet as base for sketch). Thermal infrared cameras or emergence surveys can be used to document bat use.

Use of presence/absence summer surveys may also be used if the following apply:

- A presence/absence summer survey is already necessary because there will be tree removal associated with the project. The results of the presence/absence summer survey for a near-by project is not sufficient. The survey should be specific for the project in question.
- Survey points over water/edge of water (if there is a small stream) should be incorporated in the study plan.
- Survey points should be identified first based on the habitat on site then, if a point is not within 0.25 miles of a bridge, an additional level-of-effort is necessary. Either a survey point should be added within 0.25 miles, or the previous mentioned techniques (bridge inspection, emergence survey, thermal infrared cameras) should be used.
- The Service Field Office is required to review the survey SOW.
- If the bridge is within a known maternity colony home range a bridge assessment is required.

**Sound**

Listen for high pitched squeaking or chirping during the assessment and identify location(s) for later examination by DOT staff. This may be helpful in locating bats within deep cracks or open joints. A sketch map would be helpful.

**Droppings (Guano)**

Bat droppings are small (mouse-like in appearance but less regular) brown or black pellets (Photos 6 - 8). Older droppings may be gray in color. These droppings will accumulate on the ground, floor of a covered bridge or on structural components below where bats roost. Droppings may also adhere to support beams and walls below roosts.

Note bat droppings and their location. Check under likely roosting spots such as cracks, cave-like areas, and expansion joints. If guano is present, the inspector may wish to wear a dust mask. Also, it is advisable to wear rubber boots to minimize tracking of any guano into vehicle(s) and other places.

**Staining**

Stains may appear wet and are usually found in dark places. Look for four to six inch wide dark stains located on concrete support beams and walls immediately below the ceiling of the bridge, and beneath joints (Photos 8 - 11).

Literature Cited

Bernardin, Lochmueller, and Associates, Inc. 2007. Bridge Inspection Checklist for Bats. Unpublished. Evansville, Indiana.

Indiana Department of Transportation. 2012. INDOT Bridge Inspection Manual. Indiana. Available from: [http://www.in.gov/dot/div/contracts/standards/bridge/inspector\\_manual/index.htm](http://www.in.gov/dot/div/contracts/standards/bridge/inspector_manual/index.htm).

Keeley, Brian W. and Merlin D. Tuttle. 1999. Bats in American Bridges. Bat Conservation International, Inc., Austin, TX. Resource Publication No. 4, 41 pp.

## Photos \*

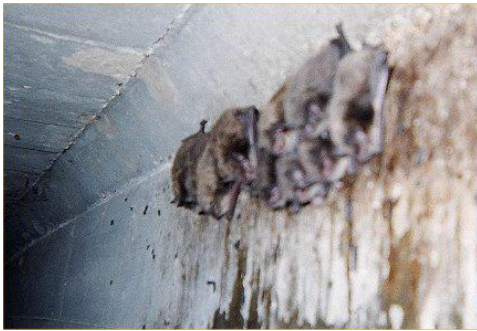


Photo 1: Bats hanging from cracks along Support beams



Photo 2: Visible bats within an expansion joint



Photo 3: Example of open concrete joint used by bats



Photo 4: Guano deposits visible from bridge deck, on top of pier



Photo 5: Guano deposit on pier, obscuring structural features.



Photo 6: Bat Guano on Riprap



Photo 7: Staining along longitudinal joint. Note guano deposits on the ground. Photo 8: Staining on underside of expansion joint from bat use.



Photo 9: Staining on sides of pier caps





Photo 10: Guano staining on side of pier



Photo 11: Bats Roosting & Associated Staining



Photo 12 and 13: Bridge Design Mimicking “Cave-like” Atmosphere



Photo 14: NLEBs Roosting Under a Timber Decked Bridge

\* Photos courtesy of Tom Cervone, Bernardin, Lochmueller and Associates, Jeff Gore, Florida Fish and Wildlife Conservation Commission, Rick Reynolds, Virginia Department of Game and Inland Fisheries, and Kraig McPeck, U.S. Fish & Wildlife Service.

## APPENDIX C: Bridge/Structure Assessment Form

### Bridge Assessment Form

This form will be completed and submitted to the District Environmental Manager by the Contractor prior to conducting any work below the deck surface either from the underside, from activities above that bore down to the underside, or that could impact expansion joints, from deck removal on bridges, or from structure demolish. Each bridge/structure to be worked on must have a current bridge inspection. Any bridge/structure suspected of providing habitat for any species of bat will be removed from work schedules until such time that the DOT has obtained clearance from the US Fish and Wildlife Service, if required. Additional studies may be undertaken by the DOT to determine what species may be utilizing structures prior to allowing any work to proceed.

DOT Project #	Water Body	Date/Time of Inspection
---------------	------------	-------------------------

Route:	County:	Federal Structure ID:	Bat Indicators				Notes: (e.g., number & species of bats, if known. Include the results of thermal, emergent, or presence/absence summer survey)
Check all that apply. Presence of one or more indicators is sufficient evidence that bats may be using the structure.							
			Visual	Sound	Droppings	Staining	

Areas Inspected (Check all that apply)

Bridges		Culverts/Other Structures		Summary Info (circle all that apply)			
All vertical crevices sealed at the top and 0.5-1.25" wide & ≥4" deep		Crevices, rough surfaces or imperfections in concrete		Human disturbance or traffic under bridge/in culvert or at the structure	High	Low	None
All crevices >12" deep & not sealed		Spaces between walls, ceiling joists		Possible corridors for netting	None/poor	Marginal	excellent



All guardrails				Evidence of bats using bird nests, if present?	Yes	No	
All expansion joints							
Spaces between concrete end walls and the bridge deck							
Vertical surfaces on concrete I-beams							

Assessment Conducted By: \_\_\_\_\_

Signature(s):

District Environmental Use Only:

Date Received by District Environmental Manager: \_\_\_\_\_

#### DOT Bat Assessment Form Instructions

1. Assessments must be completed a minimum of 1 year prior to conducting any work below the deck surface on all bridges that meet the physical characteristics described in the Programmatic Informal Consultation, regardless of whether assessments have been conducted in the past. **Due to the transitory nature of bat use, a negative result in one year does not guarantee that bats will not use that structure in subsequent years.**
2. Legible copies of this document must be provided to the District Environmental Manager within two (2) business days of completing the assessment. Failure to submit this information will result in that structure being removed from the planned work schedule.
3. Any bridge/structure suspected of providing habitat for any species of bat will be removed from work schedules until such time that the DOT has obtained clearance from the USFWS, if required. Additional studies may be undertaken by the DOT to determine what species may be utilizing each structure identified as supporting bats prior to allowing any work to proceed.
4. Estimates of numbers of bats observed should be place in the Notes column.
5. Any questions should be directed to the District Environmental Manager.